

LINCOLNTON—LINCOLN CO RGNL (IPJ)(KIPJ) 5 E UTC-5(-4DT) N35°28.99' W81°09.69'**CHARLOTTE**

878 B NOTAM FILE IPJ

H-9B, 12G, L-25D**RWY 05-23:** H5700X100 (ASPH) S-30, D-60 MIRL 0.3% UP SW**IAP****RWY 05:** REIL. PAPI(P2L)—GA 3.4° TCH 64'. Thld dsplcd 200'. Trees.**RWY 23:** REIL. PAPI(P2L)—GA 3.0° TCH 47'. Thld dsplcd 199'. Trees.**SERVICE:** S4 **FUEL** 100LL, JET A1+ **OX** 2, 4 **LGT** To actvt REIL Rwy 05 & 23 dusk-dawn—CTAF; to actvt PAPI Rwy 05 & 23—CTAF. MIRL Rwy 05-23 dusk to 0300Z† preset low intst; to incr intst dusk to 0300Z† and to actvt MIRL Rwy 05-23 between 0300Z†-dawn—CTAF.**AIRPORT REMARKS:** Attended Apr-Oct 1300-0000Z†, Nov-Mar

1300-2300Z†. Unattended Thanksgiving and Christmas Day. Deer, coyote and birds on and invof arpt. Rwy 23 has a 90 ft drop-off 100 ft fm pvmt end and 90 ft drop-off first 200 ft 160 ft both sides of cntrln. 200 ft swy SW end has been remarked as 200 ft dsplcd thr for Rwy 05.

AIRPORT MANAGER: 704-680-2651**WEATHER DATA SOURCES:** AWOS-3 119.675 (704) 735-6954.**COMMUNICATIONS:** CTAF/UNICOM 123.05Ⓡ **CHARLOTTE APP/DEP CON** 134.75 **CLNC DEL** 124.9**GCO** 124.9 (CHARLOTTE APCH) (Key mike 4 times slowly, wait for dial tone and ring)**CLEARANCE DELIVERY PHONE:** For CD if una via GCO ctc Charlotte Apch at 704-359-0241.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.**CHARLOTTE (L) (L) VORW/DME** 115.0 CLT Chan 97 N35°11.42' W80°57.11' 335° 20.3 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

185°-202° byd 15 NM

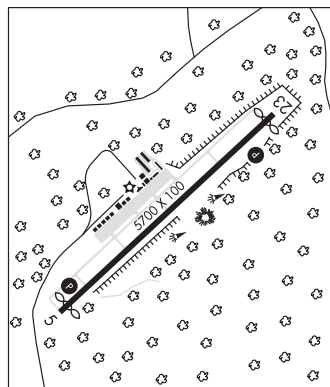
203°-220°

270°-350° byd 20 NM blo 5,000'

VOR/DME controlled by Charlotte ATCT

VOR unusable:

203°-220°

ILS/DME 111.15 I-IPJ Chan 48(Y) Rwy 23. Class IB.**LONE HICKORY** (See YADKINVILLE on page 366)**LOUISBURG****TRIANGLE NORTH EXEC** (LHZ)(KLHZ) 5 SW UTC-5(-4DT) N36°01.40' W78°19.82'**CHARLOTTE**

368 B NOTAM FILE LHZ

H-9C, 12H, L-35B, 36G**RWY 05-23:** H5498X100 (ASPH-GRVD) S-40, D-60**IAP**

PCR 240 F/C/X/T HIRL 0.7% up SW

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 42'. Trees. Rgt ttc.**RWY 23:** REIL. PAPI(P4L)—GA 3.0° TCH 49'. Trees.**SERVICE:** S4 **FUEL** 100LL, JET A1+ **OX** 3, 4 **LGT** Actvt MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23—CTAF. PAPI Rwy 05 and 23 oper consly.**AIRPORT REMARKS:** Attended 1300-2300Z†. Arpt unattended

Thanksgiving Day and Christmas. Birds on and invof arpt. Daily skydiving ops. Glider act dalgt hrs wkends. Hel fit tng dly primly on W side of arpt and twy. Arpt phone 919-496-1234; make prior arngmts drg FBO hrs for svcs aft hrs.

AIRPORT MANAGER: 919-496-1234**WEATHER DATA SOURCES:** AWOS-3 118.325 (919) 497-0810.**COMMUNICATIONS:** CTAF/UNICOM 123.0Ⓡ **RALEIGH APP/DEP CON** 125.3**CLEARANCE DELIVERY PHONE:** For CD ctc Raleigh Apch at 919-380-3144.**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.**RALEIGH/DURHAM (H) (H) VORTACW** 117.2 RDU Chan 119

N35°52.35' W78°47.00' 077° 23.9 NM to fld. 429/9W.

ILS/DME 109.35 I-LHZ Chan 30(Y) Rwy 05. Class IA. ILS mnt at fbo. Glideslope autopilot cpd apch NA blw 600' MSL.